

## Jotazone

---

### Product description

This is a two component polyamine cured epoxy coating. It is a high solids, high build, abrasion resistant product. Can be used as primer, finish coat or as single coat system in atmospheric and immersed environments. Suitable for properly prepared carbon steel and concrete substrates.

### Scope

The Application Guide offers product details and recommended practices for the use of the product.

The data and information provided are not definite requirements. They are guidelines to assist in smooth and safe use, and optimum service of the product. Adherence to the guidelines does not relieve the applicator of responsibility for ensuring that the work meets specification requirements. Jotuns liability is in accordance with general product liability rules.

The Application Guide (AG) must be read in conjunction with the relevant specification, Technical Data Sheet (TDS) and Safety Data Sheet (SDS) for all the products used as part of the coating system.

### Referred standards

Reference is generally made to ISO Standards. When using standards from other regions it is recommended to reference only one corresponding standard for the substrate being treated.

---

### Surface preparation

The required quality of surface preparation can vary depending on the area of use, expected durability and if applicable, project specification.

When preparing new surfaces, maintaining already coated surfaces or aged coatings it is necessary to remove all contamination that can interfere with coating adhesion, and prepare a sound substrate for the subsequent product.

Inspect the surface for hydrocarbon and other contamination and if present, remove with an alkaline detergent. Agitate the surface to activate the cleaner and before it dries, wash the treated area using fresh water. Paint solvents (thinners) shall not be used for general degreasing or preparation of the surface for painting due to the risk of spreading dissolved hydrocarbon contamination. Paint thinners can be used to treat small localized areas of contamination such as marks from marker pens. Use clean, white cotton cloths that are turned and replaced often. Do not bundle used solvent saturated cloths. Place used cloths into water. When the surface is an existing coating, verify with technical data sheet and application guide of the involved products, both over coatability and the given maximum over coating interval.

#### Process sequence

Surface preparation and coating should normally be commenced only after all welding, degreasing, removal of sharp edges, weld spatter and treatment of welds is complete. It is important that all hot work is completed before coating commences.

### Carbon steel

#### Initial rust grade

The steel shall preferably be Rust Grade A or B (ISO 8501-1). It is technically possible to apply the coating to rust grades C and D, but it is practically challenging to ensure specified film thickness on such a rough surface, hence risk of reduced lifetime of the coating system. When steel of Rust Grade C or D is coated, the frequency of inspection and testing should be increased.

#### Metal finishing

All welds, sharp edges and corners shall be finished to minimum grade P2 (ISO 8501-3) Table 1. Defective welds shall be replaced and treated to an acceptable finish before painting. Temporary welds and brackets shall be ground to a flat finish after removal from the parent metal. All edges shall be ground to a minimum radius of 2.0 mm after a minimum three passes with a mechanical grinder fitted with appropriate abrasive. All sharp irregularities, burrs, slivers, slag and spatter on welds, whether apparent before or after blast cleaning, shall be removed before the commencement of coating application. Weld smoke shall be removed by washing by low-pressure Water Cleaning LP WC method to Wa 1 (ISO 8501-4) using fresh water.

## Abrasive blast cleaning

### Cleanliness

After pre-treatment is complete, the surface shall be dry abrasive blast cleaned to Sa 2½ (ISO 8501-1) using abrasive media suitable to achieve a sharp and angular surface profile.

### Surface profile

Recommended surface profile 50-85 µm, grade Medium G (ISO 8503-2).

### Abrasive media quality

The selected abrasive must be compatible with both the surface to be blast cleaned and the specified coating system. The abrasive shall meet specifications as per relevant parts of ISO 11124 (Specification for metallic blast-cleaning abrasives), or ISO 11126 (Specification for non-metallic blast-cleaning abrasives). It should be sampled and tested as per relevant parts of ISO 11125 (metallic abrasives) or ISO 11127 (non-metallic abrasives). Dry storage of abrasive and shelter for blasting pots is necessary to prevent equipment becoming clogged with damp abrasive.

All abrasive blast media used should be new and not recirculated, with the exception of Steel Grit. If this is utilized the circulation process must include a cleaning process. Dry storage of abrasive and shelter for blasting pots is necessary to prevent equipment becoming clogged with damp abrasive. Recycling of used abrasive is prohibited unless approved by Jotun.

### Compressed air quality

The supply of clean air to blasting pots must be secured to avoid contamination of abrasive and thereby of blast cleaned surfaces. Compressors must be fitted with sufficient traps for oil and water. It is also recommended to fit two water separators at the blasting machine to ensure a supply of moisture-free air to the abrasive chamber.

### Dust contamination

Dust must be removed just before application of the paint to a dust quantity rating 1 for dust size class 3, 4 or 5 according to ISO 8502-3. Lower dust size classes shall be removed from the surface if visible without magnification. At the completion of abrasive blasting the prepared surface shall be cleaned to remove residues of corrosion products and abrasive media, and inspected for surface particulate contamination. Maximum contamination level is rating 2 (ISO 8502-3) as per Figure 1. Dust size no greater than class 2.

## Hand and Power Tool Cleaning

### Power tool cleaning

Mechanical surface preparation is recommended for small repair areas only. See section coating repair for further information. Surfaces to be coated shall be prepared by mechanical cleaning methods to St 2 or St 3 (ISO 8501-1) as specified using methods such as disc grinding, needle gun, hand sanding or hand wire brushing methods to ensure the surface is free from residual corrosion, failed coating and suitable for painting. If power wire brushing is used, care should be taken not to polish the metal surface, as this can reduce adhesion of the coating. Remaining intact coating shall have all leading edges "feathered back" by sanding methods to remove all sharp leading edges and establish a smooth transition from the exposed substrate to the surrounding coating. Abrade intact coatings around the damaged areas for a minimum 75 mm to impart a surface profile and to degloss the coating.

## Galvanised steel

### Abrasive blast cleaning

The surface to be coated shall be dry abrasive blast cleaned to NACE No. 4 / SSPC-SP 7 Brush-Off Blast Cleaning as required for the specified surface profile using approved non-metallic abrasive media which is suitable to achieve a sharp and angular surface profile. As a guide, surface profile 25-55µm should be achieved. Examples of recommended abrasives are:

- Ferrite free almandite garnet grade 30/60 and 80 grade (US Mesh size)
- Aluminium oxide grade G24 Jotun recommends the following for Brush (Sweep) Blasting HDG and other alloys:
  - The Blasting Air Pressure should be 2.8 Bar (40 psi) at the blast nozzle
  - Use Clean Garnet of 90 mesh size
  - Angle of blasting to the surface should be a 45° angle
  - Distance of the nozzle to the surface should be 400-500 mm
  - Use a 10mm venturi nozzle Finished surfaces shall be dull, profiled and show no areas of shiny metal. Do not handle the prepared surface with bare hands. Apply the initial coating within 2 hours of completing the blasting.

## Aluminium

### Abrasive blast cleaning

The surface to be coated shall be dry abrasive blast cleaned as required for the specified surface profile using approved non-metallic abrasive media which is suitable to achieve a sharp and angular surface profile. As a guide, a surface profile between 25-55 microns, grade Fine G; Ry5 to ISO 8503-2 should be achieved. Examples of recommended abrasives are:

- Ferrite free almandite garnet grade 30/60 and 80 grade (US Mesh size)
- Aluminium oxide grade G24 Finished surfaces shall be dull, profiled and show no areas of shiny metal. Do not handle the prepared surface with bare hands. At the completion of abrasive blasting the prepared surface shall be cleaned to remove residues of corrosion products and abrasive media, and inspected for surface particulate contamination. Maximum contamination level is corresponding to rating 2 (ISO 8502-3) as per Figure 1 unless otherwise specified.

Finished surfaces shall be dull, profiled and show no areas of shiny metal.

Do not handle the prepared surface with bare hands. Avoid surface contamination by handling the surface with bare hands. Apply the initial coating within 2 hours of completing the blasting.

### Water jetting

Inspect the surface for oil and hydrocarbon contamination and if present, remove with an alkaline detergent. Agitate the surface to activate the detergent and before it dries, wash the treated area by high-pressure Water Cleaning HPWC to Wa 1 (ISO 8501-4) using fresh water in order to remove contamination and reduce salt concentration.

## Stainless steel

### Abrasive blast cleaning

The surface to be coated shall be dry abrasive blast cleaned as required for the specified surface profile using non-metallic abrasive media which is suitable to achieve a sharp and angular surface profile. As a guide, a surface profile corresponding to 25-55 µm, grade Fine G; Ry5 (ISO 8503-2) should be achieved. Examples of recommended abrasives are:

- Ferrite free almandite garnet grade 30/60 and 80 grade (US Mesh size)
- Aluminium oxide grade G24 Finished surfaces shall be dull, profiled and show no areas of shiny metal. At the completion of abrasive blasting the prepared surface shall be cleaned to remove residues of corrosion products and abrasive media, and inspected for surface particulate contamination. Maximum contamination level is corresponding to rating 2 (ISO 8502-3) as per Figure 1 unless otherwise specified.

Finished surfaces shall be dull, profiled and show no areas of shiny metal.

Do not handle the prepared surface with bare hands. Apply the initial coating within 2 hours of completing the blasting.

### Water jetting

Inspect the surface for oil and hydrocarbon contamination and if present, remove with an alkaline detergent. Agitate the surface with non-metallic brushes to activate the detergent and before it dries, wash the treated area by low-pressure Water Cleaning (LPWC) to a grade corresponding to the description of Wa 1 (ISO 8501-4) or higher standard using fresh water to remove contamination and reduce salt concentration.

Chlorinated or chlorine containing solvents or detergents must not be used on stainless steel.

## Concrete

Concrete should be a minimum of 28 days old, applying any coating before this time will greatly increase the chance of the coating de-bonding. The moisture content of the concrete should be checked prior to the application of the coating and should not be greater than 5%. Concrete substrates should be mechanically prepared to leave a clean, sound and dry base on which a coating system can be applied.

Clean – Free of oils, grease, dust, dirt, chemicals, loose coating, curing compounds, form release oils, sealers or hardeners must be removed prior to coating.

Sound – Concrete that has unsound areas (voids, hollow spots, and friable surface) may have to be removed, replaced or repaired with materials that are compatible with the selected coating system.

Dry – It is important to address dryness because most coatings require a dry surface for proper adhesion.

Moisture contained within the concrete that moves towards the surface through the pores of the concrete may prevent adequate coating adhesion.

Dry abrasive blast cleaning to SSPC-SP 13/NACE No. 6. Where the concrete has become contaminated with oils, grease, or fuels, water emulsifiable degreasers-cleaners may be used to remove these contaminants. It is important to only clean an area that can be fully washed down after degreasing before any of the cleaner can dry on the surface.

Ultra high pressure water jetting can be used to remove laitance and reveal blowholes and imperfections.

Ensure concrete is dry before coating application.

### Sand sweeping

Dry abrasive blast cleaning to SSPC-SP 13/NACE No. 6. All prepared surfaces should then have all "blow holes" and other surface defects filled with suitable filler that is compatible with the primer and finish coat system to ensure that the coating can be applied over a smooth and regular substrate.

### Diamond disc grinding

Diamond grind the surface to remove all laitance and expose the aggregates.

## Coated surfaces

### Verification of existing coatings including primers

Previously coated surfaces shall be free from contamination by water, hydrocarbon based products, wax, mud, mortar droppings and loose, chalked and flaking coating. Inspect the surface for hydrocarbon and other contamination and if present, remove with an alkaline emulsifying detergent. Agitate the surface to activate the cleaner and before it dries, wash the treated area by low-pressure waterjetting method to Wa 1 (ISO 8501-4) using fresh water. Surfaces not contaminated with hydrocarbon deposits shall be washed to Wa 1 (ISO 8501-4) using fresh water to reduce surface chlorides. Paint solvents (thinners) shall not be used for general degreasing or preparation of the surface for painting due to the risk of spreading dissolved hydrocarbon contamination. Damaged areas of the coating shall be abrasive brush-off blast cleaned to NACE No. 4/SSPC-SP 7 or sanded by hand, disc or orbital sander or abrasive blast cleaned to bare metal as specified for the particular coating system to be applied. Leading edges of damaged coating shall be "feathered back" by abrasive sanding methods to remove all sharp edges and to ensure a smooth transition from the intact coating to the substrate. Intact coating shall be assessed to ensure the surface is clean and is capable of providing adhesion to the new coating. If required, the surface should be abrasive brush-off blast cleaned to NACE No. 4/SSPC-SP 7 or sanded by hand, disc or orbital sanding methods to remove chalk and to impart a surface profile suitable for the adhesion of the new coating. Remove all old paint and sanding residues before applying the coating.

### Shop primers

Shop primers are accepted as temporary protection of steel plates and profiles. Refer to the technical data sheet for the generic types accepted. Certain standards require pre-approval of the shop primer as part of a complete system. Contact your nearest Jotun office for specific system compatibility. When overcoating the shop primer must be dry, clean and undamaged

## Application

### Acceptable environmental conditions - before and during application

Before application, test the atmospheric conditions in the vicinity of the substrate for the dew formation according to ISO 8502-4.

Air temperature	10 - 40	°C
Substrate temperature	10 - 40	°C
Relative Humidity (RH)	10 - 85	%

The following restrictions must be observed:

- Only apply the coating when the substrate temperature is at least 3 °C (5 °F) above the dew point
- Do not apply the coating if the substrate is wet or likely to become wet
- Do not apply the coating if the weather is clearly deteriorating or unfavourable for application or curing
- Do not apply the coating in high wind conditions

## Product mixing

### Product mixing ratio (by volume)

Jotazone Comp A	6 part(s)
Jotazone Comp B	1 part(s)

### Thinner/Cleaning solvent

Thinner: Jotun Thinner No. 17

## Application data

### Airless Spray Equipment

Pump ratio (minimum) :	42:1
Pump output (litres/minute) :	2.2-3.4
Pressure at nozzle (minimum) :	200 bar/2900 psi
Nozzle tip (inch/1000) :	21-27
Filters (mesh) :	50-70

Several factors influence, and need to be observed to maintain the recommended pressure at nozzle. Among factors causing pressure drop are:

- long paint- and whip hoses
- low inner diameter hoses
- high paint viscosity
- large spray nozzle size
- inadequate air capacity from compressor
- wrong or clogged filters

## Film thickness per coat

### Typical recommended specification range

Dry film thickness	200 - 800	µm
Wet film thickness	245 - 975	µm
Theoretical spreading rate	4,1 - 1	m <sup>2</sup> /l

## Film thickness measurement

### Wet film thickness (WFT) measurement and calculation

To ensure correct film thickness, it is recommended to measure the wet film thickness continuously during application using a painter's wet film comb (ISO 2808 Method 1A). Use a wet-to-dry film calculation table to calculate the required wet film thickness per coat.

A wet to dry film thickness chart is available on the Jotun Web site.

### Dry film thickness (DFT) measurement

When the coating has cured to hard dry state the dry film thickness can be checked to SSPC PA 2 or equivalent standard using statistical sampling to verify the actual dry film thickness. Measurement and control of the WFT and DFT on welds is done by measuring adjacent to and no further than 15 cm from the weld.

### Ventilation

Sufficient ventilation is very important to ensure proper drying/curing of the film.

### Stripe coating

The stripe coat sequence can be either of the following:

1. Surface preparation, stripe coat, full coat.
2. Surface preparation, full coat, stripe coat. This sequence can be used when a large substrate area has been prepared and leaving the substrate exposed for a long time while doing stripe coating could lead to surface deterioration. It is important to pay special attention to edges, openings, rear sides of stiffeners, scallops etc. and to apply a stripe coat to these areas where the spray fan may not reach or deposit an even film.

When applying a stripe coat to bare metal use only a stiff, round stripe coating brush to ensure surface wetting and filling of pits in the surface. Stripe coating shall be of a different colour to the main primer coat and the topcoat colour and should be applied in an even film thickness, avoiding excessive brush marks in order to avoid entrapped air. Care should be taken to avoid excessive film thickness. Pay additional attention to pot life during application of stripe coats. Jotun recommends a minimum of one stripe coat. However, in extremely aggressive exposure conditions there may be good reason to specify two stripe coats.

### Drying process

Do not attempt to speed up the curing process by blowing hot air on to the wet coating film as this may lead to skin drying/curing, entrapped solvents and consequently solvent blistering and inferior corrosion protection.

### Coating loss

The consumption of paint should be controlled carefully, with thorough planning and a practical approach to reducing loss. Application of liquid coatings will result in some material loss. Understanding the ways that coating can be lost during the application process, and making appropriate changes, can help reducing material loss. Some of the factors that can influence the loss of coating material are:

- type of spray gun/unit used
- air pressure used for airless pump or for atomization
- orifice size of the spray tip or nozzle
- fan width of the spray tip or nozzle
- the amount of thinner added
- the distance between spray gun and substrate
- the profile or surface roughness of the substrate. Higher profiles will lead to a higher "dead volume"
- the shape of the substrate target
- environmental conditions such as wind and air temperature

## Drying and Curing time

Substrate temperature	10 °C	23 °C	40 °C
Surface (touch) dry	8 h	4 h	2 h
Walk-on-dry	24 h	10 h	4 h
Dry to over coat, minimum	24 h	10 h	4 h
Dry to over coat, maximum, atmospheric	14 d	7 d	2 d
Dried/cured for service	14 d	7 d	2 d

Drying and curing times are determined under controlled temperatures and relative humidity below 85 %, and at average of the DFT range for the product.

Surface (touch) dry: The state of drying when slight pressure with a finger does not leave an imprint or reveal tackiness.

Walk-on-dry: Minimum time before the coating can tolerate normal foot traffic without permanent marks, imprints or other physical damage.

Dry to over coat, minimum: The shortest time allowed before the next coat can be applied.

Dry to over coat, maximum, atmospheric: The longest time allowed before the next coat can be applied.

Dried/cured for service: Minimum time before the coating can be permanently exposed to the intended environment/medium.

## Maximum over coating intervals

Maximum time before thorough surface preparation is required. The surface must be clean and dry and suitable for over coating. Inspect the surface for chalking and other contamination and if present, remove with an alkaline detergent. Agitate the surface to activate the cleaner and before it dries, wash the treated area by low-pressure water jetting to Wa 1 (ISO 8501-4) using fresh water.

If maximum over coating interval is exceeded the surface should in addition be carefully roughened to ensure good inter coat adhesion.

### Areas for atmospheric exposure

Average temperature during drying/curing	10 °C	23 °C	40 °C
Itself	3 mth	3 mth	2 mth
epoxy	3 mth	3 mth	2 mth
epoxy mastic	3 mth	3 mth	2 mth
polyurethane	10 d	7 d	5 d

### Areas for immersed exposure

Average temperature during drying/curing	10 °C	23 °C	40 °C
Itself	14 d	14 d	10 d
epoxy	14 d	14 d	10 d
epoxy mastic	14 d	14 d	10 d
vinyl epoxy	7 d	7 d	6 d

### Other conditions that can affect drying / curing / over coating

#### Adding anti-skid to the coating system

Anti skid aggregate should only be added in the final coat, and should not be used in single coat systems. Spread the aggregate evenly on the surface before half of time to Surface dry. Use Jotun Anti-skid, medium particle size (400 - 600 µm) for coatings applied in 150 to 400 µm DFT. The recommended usage is 2.5 - 3.3 kg per 10 litres of paint.

#### Repair of coating system

Damages to the coating layers:

Prepare the area through sandpapering or grinding, followed by thorough cleaning/vacuuming. When the surface is clean and dry the coating may be over coated by itself or by another product, ref. original specification.

Always observe the maximum over coating intervals. If the maximum over coating interval is exceeded the surface should be carefully roughened in order to ensure good intercoat adhesion. Damages exposing bare substrate:

Remove all rust, loose paint, grease or other contaminants by spot blasting, mechanical grinding, water and/or solvent washing. Feather edges and roughen the overlap zone of surrounding intact coating. Apply the coating system specified for repair.

#### Repair of damaged areas

Sags and runs can be caused by too high wet film thickness, too much thinner added or the spray gun used too close to the surface.

Repair by using a paint brush to smooth the film when still wet.

Sand down to a rough, even surface and re-coat if the coating is cured. Orange peel can be caused by poor flow/levelling properties of the paint, poor atomization of the paint, thinner evaporating too fast or the spray gun held too close to the surface.

This can be rectified by abrading the surface and applying an additional coat after having adjusted the application properties or the application technique. Dry spray can be caused by poor atomization of the paint, spray gun held too far from the surface, high air temperature, thinner evaporating too fast or coating applied in windy conditions. Sand down to a rough even surface and re-coat. Pinholes can be caused by entrapped solvents in the film or by incorrect application technique. Pinholes can be repaired as per procedure for damages to the coating layer or to the substrate, ref. above.

#### Coating film continuity

When required by the specification, the coating shall be tested for film discontinuity according to ASTM D 5162, test method A or B as appropriate for the actual dry film thickness.

All recorded defects shall be repaired by best practical means.



## Quality assurance

The following information is the minimum required. The specification may have additional requirements.

- Confirm that all welding and other metal work has been completed before commencing pre-treatment and surface preparation
- Confirm that installed ventilation is balanced and has the capacity to deliver and maintain the RAQ
- Confirm that the required surface preparation standard has been achieved and is held prior to coating application
- Confirm that the climatic conditions are within recommendations in the AG, and are held during the application
- Confirm that the required number of stripe coats have been applied
- Confirm that each coat meets the DFT requirements in the specification
- Confirm that the coating has not been adversely affected by rain or other factors during curing
- Observe that adequate coverage has been achieved on corners, crevices, edges and surfaces where the spray gun cannot be positioned so that its spray impinges on the surface at 90° angle
- Observe that the coating is free from defects, discontinuities, insects, abrasive media and other contamination
- Observe that the coating is free from misses, sags, runs, wrinkles, fat edges, mud cracking, blistering, obvious pinholes, excessive dry spray, heavy brush marks and excessive film build
- Observe that the uniformity and colour are satisfactory

All noted defects shall be fully repaired to conform to the coating specification.

### Caution

This product is for professional use only. The applicators and operators shall be trained, experienced and have the capability and equipment to mix/stir and apply the coatings correctly and according to Jotun's technical documentation. Applicators and operators shall use appropriate personal protection equipment when using this product. This guideline is given based on the current knowledge of the product. Any suggested deviation to suit the site conditions shall be forwarded to the responsible Jotun representative for approval before commencing the work.

For further advice please contact your local Jotun office.

### Health and safety

Please observe the precautionary notices displayed on the container. Use under well ventilated conditions. Do not inhale spray mist. Avoid skin contact. Spillage on the skin should immediately be removed with suitable cleanser, soap and water. Eyes should be well flushed with water and medical attention sought immediately.

### Accuracy of information

Always refer to and use the current (last issued) version of the TDS, SDS and if available, the AG for this product. Always refer to and use the current (last issued) version of all International and Local Authority Standards referred to in the TDS, AG & SDS for this product.

### Colour variation

Some coatings used as the final coat may fade and chalk in time when exposed to sunlight and weathering effects. Coatings designed for high temperature service can undergo colour changes without affecting performance. Some slight colour variation can occur from batch to batch. When long term colour and gloss retention is required, please seek advice from your local Jotun office for assistance in selection of the most suitable top coat for the exposure conditions and durability requirements.

### Reference to related documents

The Application Guide (AG) must be read in conjunction with the relevant specification, Technical Data Sheet (TDS) and Safety Data Sheet (SDS) for all the products used as part of the coating system.

When applicable, refer to the separate application procedure for Jotun products that are approved to classification societies such as PSPC, IMO etc.

---

## Symbols and abbreviations

min = minutes  
h = hours

TDS = Technical Data Sheet  
AG = Application Guide

d = days  
°C = degree Celsius  
° = unit of angle  
µm = microns = micrometres  
g/l = grams per litre  
g/kg = grams per kilogram  
m<sup>2</sup>/l = square metres per litre  
mg/m<sup>2</sup> = milligrams per square metre  
psi = unit of pressure, pounds/inch<sup>2</sup>  
Bar = unit of pressure  
RH = Relative humidity (% RH)  
UV = Ultraviolet  
DFT = dry film thickness  
WFT = wet film thickness

SDS = Safety Data Sheet  
VOC = Volatile Organic Compound  
MCI = Jotun Multi Colour Industry (tinted colour)  
RAQ = Required air quantity  
PPE = Personal Protective Equipment  
EU = European Union  
UK = United Kingdom  
EPA = Environmental Protection Agency  
ISO = International Standards Organisation  
ASTM = American Society of Testing and Materials  
AS/NZS = Australian/New Zealand Standards  
NACE = National Association of Corrosion Engineers  
SSPC = The Society for Protective Coatings  
PSPC = Performance Standard for Protective Coatings  
IMO = International Maritime Organization

---

## Disclaimer

The information in this document is given to the best of Jotun's knowledge, based on laboratory testing and practical experience. Jotun's products are considered as semi-finished goods and as such, products are often used under conditions beyond Jotun's control. Jotun cannot guarantee anything but the quality of the product itself. Minor product variations may be implemented in order to comply with local requirements. Jotun reserves the right to change the given data without further notice.

Users should always consult Jotun for specific guidance on the general suitability of this product for their needs and specific application practices.

If there is any inconsistency between different language issues of this document, the English (United Kingdom) version will prevail.

---