

Tankguard HB Classic Comp A

Section 1. Identification

Product name	: Tankguard HB Classic Comp A
Code	: 30382
Product description	: Paint.
Product type	: Liquid.
Other means of identification	: Not available.

Relevant identified uses of the substance or mixture and uses advised against

Identified uses

Use in coatings - Industrial use
Use in coatings - Professional use

Supplier	: Jotun Australia Pty. Ltd. 59 Calarco Drive, Derrimut, VIC 3026, Australia Phone: + 61 39314 0722 E-mail: SDSJotun@jotun.com
-----------------	--


Emergency telephone number	: Medical Emergencies 24 hours: Poisons Information Centre (Australia) 131 126
-----------------------------------	--

Section 2. Hazard(s) identification

Classification of the substance or mixture	: FLAMMABLE LIQUIDS - Category 3 SKIN CORROSION/IRRITATION - Category 2 SERIOUS EYE DAMAGE/EYE IRRITATION - Category 1 SKIN SENSITISATION - Category 1 LONG-TERM (CHRONIC) AQUATIC HAZARD - Category 3
---	--

GHS label elements

Hazard pictograms

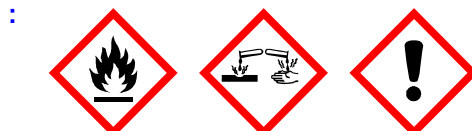

Signal word : DANGER

Hazard statements : H226 - Flammable liquid and vapour.
H315 - Causes skin irritation.
H317 - May cause an allergic skin reaction.
H318 - Causes serious eye damage.
H412 - Harmful to aquatic life with long lasting effects.

Precautionary statements

Section 2. Hazard(s) identification

- Prevention** : P280 - Wear protective gloves. Wear eye or face protection.
P210 - Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking.
P273 - Avoid release to the environment.
P261 - Avoid breathing vapour.
- Response** : P362 + P364 - Take off contaminated clothing and wash it before reuse.
P302 + P352 - IF ON SKIN: Wash with plenty of water.
P333 + P313 - If skin irritation or rash occurs: Get medical advice or attention.
P305 + P351 + P338, P310 - IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.
Immediately call a POISON CENTER or doctor.
- Storage** : Not applicable.
- Disposal** : P501 - Dispose of contents and container in accordance with all local, regional, national and international regulations.
- Supplemental label elements** : Not applicable.
- Other hazards which do not result in classification** : None known.

Section 3. Composition and ingredient information

- Substance/mixture** : Mixture
- Other means of identification** : Not available.

CAS number/other identifiers

- CAS number** : Not applicable.
- EC number** : Mixture.
- Product code** : 30382

Ingredient name	% (w/w)	CAS number
xylene	≤12	1330-20-7
epoxy resin (MW 700-1200)	≥10 - ≤30	25036-25-3
epoxy resin (MW ≤ 700)	≥10 - <25	1675-54-3
butan-1-ol	≤7.1	71-36-3
ethylbenzene	≤5	100-41-4

There are no additional ingredients present which, within the current knowledge of the supplier and in the concentrations applicable, are classified as hazardous to health or the environment and hence require reporting in this section.

Occupational exposure limits, if available, are listed in Section 8.

Section 4. First aid measures

Description of necessary first aid measures

- Eye contact** : Get medical attention immediately. Call a poison center or physician. Immediately flush eyes with plenty of water, occasionally lifting the upper and lower eyelids. Check for and remove any contact lenses. Continue to rinse for at least 10 minutes. Chemical burns must be treated promptly by a physician.

Section 4. First aid measures

- Inhalation** : Get medical attention immediately. Call a poison center or physician. Remove victim to fresh air and keep at rest in a position comfortable for breathing. If it is suspected that fumes are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. If not breathing, if breathing is irregular or if respiratory arrest occurs, provide artificial respiration or oxygen by trained personnel. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband.
- Skin contact** : Get medical attention immediately. Call a poison center or physician. Wash with plenty of soap and water. Remove contaminated clothing and shoes. Wash contaminated clothing thoroughly with water before removing it, or wear gloves. Continue to rinse for at least 10 minutes. Chemical burns must be treated promptly by a physician. In the event of any complaints or symptoms, avoid further exposure. Wash clothing before reuse. Clean shoes thoroughly before reuse.
- Ingestion** : Get medical attention immediately. Call a poison center or physician. Wash out mouth with water. Remove dentures if any. If material has been swallowed and the exposed person is conscious, give small quantities of water to drink. Stop if the exposed person feels sick as vomiting may be dangerous. Do not induce vomiting unless directed to do so by medical personnel. If vomiting occurs, the head should be kept low so that vomit does not enter the lungs. Chemical burns must be treated promptly by a physician. Never give anything by mouth to an unconscious person. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband.

Most important symptoms/effects, acute and delayed

Potential acute health effects

- Eye contact** : Causes serious eye damage.
- Inhalation** : No known significant effects or critical hazards.
- Skin contact** : Causes skin irritation. May cause an allergic skin reaction.
- Ingestion** : No known significant effects or critical hazards.

Over-exposure signs/symptoms

- Eye contact** : Adverse symptoms may include the following:
pain
watering
redness
- Inhalation** : No specific data.
- Skin contact** : Adverse symptoms may include the following:
pain or irritation
redness
blistering may occur
- Ingestion** : Adverse symptoms may include the following:
stomach pains

Indication of immediate medical attention and special treatment needed, if necessary

- Notes to physician** : Treat symptomatically. Contact poison treatment specialist immediately if large quantities have been ingested or inhaled.
- Specific treatments** : No specific treatment.
- Protection of first-aiders** : No action shall be taken involving any personal risk or without suitable training. If it is suspected that fumes are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. Wash contaminated clothing thoroughly with water before removing it, or wear gloves.

See toxicological information (Section 11)

Section 4. First aid measures

Section 5. Firefighting measures

Extinguishing media

- Suitable extinguishing media** : Recommended: alcohol-resistant foam, CO₂, powders, water spray.
- Unsuitable extinguishing media** : Do not use water jet.
- Specific hazards arising from the chemical** : Flammable liquid and vapour. Runoff to sewer may create fire or explosion hazard. In a fire or if heated, a pressure increase will occur and the container may burst, with the risk of a subsequent explosion. This material is harmful to aquatic life with long lasting effects. Fire water contaminated with this material must be contained and prevented from being discharged to any waterway, sewer or drain.
- Hazardous thermal decomposition products** : Decomposition products may include the following materials:
carbon dioxide
carbon monoxide
sulfur oxides
halogenated compounds
metal oxide/oxides
- Special protective actions for fire-fighters** : Promptly isolate the scene by removing all persons from the vicinity of the incident if there is a fire. No action shall be taken involving any personal risk or without suitable training. Move containers from fire area if this can be done without risk. Use water spray to keep fire-exposed containers cool.
- Special protective equipment for fire-fighters** : Fire-fighters should wear appropriate protective equipment and self-contained breathing apparatus (SCBA) with a full face-piece operated in positive pressure mode.
- Hazchem code** : •3Y

Section 6. Accidental release measures

Personal precautions, protective equipment and emergency procedures

- For non-emergency personnel** : No action shall be taken involving any personal risk or without suitable training. Evacuate surrounding areas. Keep unnecessary and unprotected personnel from entering. Do not touch or walk through spilt material. Shut off all ignition sources. No flares, smoking or flames in hazard area. Do not breathe vapour or mist. Provide adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Put on appropriate personal protective equipment.
- For emergency responders** : If specialised clothing is required to deal with the spillage, take note of any information in Section 8 on suitable and unsuitable materials. See also the information in "For non-emergency personnel".
- Environmental precautions** : Avoid dispersal of spilt material and runoff and contact with soil, waterways, drains and sewers. Inform the relevant authorities if the product has caused environmental pollution (sewers, waterways, soil or air). Water polluting material. May be harmful to the environment if released in large quantities.

Methods and material for containment and cleaning up

- Small spill** : Stop leak if without risk. Move containers from spill area. Use spark-proof tools and explosion-proof equipment. Dilute with water and mop up if water-soluble. Alternatively, or if water-insoluble, absorb with an inert dry material and place in an appropriate waste disposal container. Dispose of via a licensed waste disposal contractor.

Section 6. Accidental release measures

- Large spill** : Stop leak if without risk. Move containers from spill area. Use spark-proof tools and explosion-proof equipment. Approach the release from upwind. Prevent entry into sewers, water courses, basements or confined areas. Wash spillages into an effluent treatment plant or proceed as follows. Contain and collect spillage with non-combustible, absorbent material e.g. sand, earth, vermiculite or diatomaceous earth and place in container for disposal according to local regulations (see Section 13). Dispose of via a licensed waste disposal contractor. Contaminated absorbent material may pose the same hazard as the spilt product. Note: see Section 1 for emergency contact information and Section 13 for waste disposal.

Section 7. Handling and storage

The information in this section contains generic advice and guidance. The list of Identified Uses in Section 1 should be consulted for any available use-specific information provided in the Exposure Scenario(s).

Precautions for safe handling

- Protective measures** : Put on appropriate personal protective equipment (see Section 8). Persons with a history of skin sensitization problems should not be employed in any process in which this product is used. Do not get in eyes or on skin or clothing. Do not breathe vapour or mist. Do not ingest. Avoid release to the environment. Use only with adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Do not enter storage areas and confined spaces unless adequately ventilated. Keep in the original container or an approved alternative made from a compatible material, kept tightly closed when not in use. Store and use away from heat, sparks, open flame or any other ignition source. Use explosion-proof electrical (ventilating, lighting and material handling) equipment. Use only non-sparking tools. Take precautionary measures against electrostatic discharges. Empty containers retain product residue and can be hazardous. Do not reuse container.

- Advice on general occupational hygiene** : Eating, drinking and smoking should be prohibited in areas where this material is handled, stored and processed. Workers should wash hands and face before eating, drinking and smoking. Remove contaminated clothing and protective equipment before entering eating areas. See also Section 8 for additional information on hygiene measures.

- Conditions for safe storage, including any incompatibilities** : Store in accordance with local regulations. Store in a segregated and approved area. Store in original container protected from direct sunlight in a dry, cool and well-ventilated area, away from incompatible materials (see Section 10) and food and drink. Store locked up. Eliminate all ignition sources. Separate from oxidising materials. Keep container tightly closed and sealed until ready for use. Containers that have been opened must be carefully resealed and kept upright to prevent leakage. Do not store in unlabelled containers. Use appropriate containment to avoid environmental contamination. See Section 10 for incompatible materials before handling or use.

See Technical Data Sheet / packaging for further information.

Section 8. Exposure controls and personal protection

The information in this section contains generic advice and guidance. The list of Identified Uses in Section 1 should be consulted for any available use-specific information provided in the Exposure Scenario(s).

Control parameters

Occupational exposure limits

Section 8. Exposure controls and personal protection

xylene	Safe Work Australia (Australia, 12/2019). STEL: 655 mg/m ³ 15 minutes. STEL: 150 ppm 15 minutes. TWA: 350 mg/m ³ 8 hours. TWA: 80 ppm 8 hours.
epoxy resin (MW ≤ 700)	DFG MAC-values list (Germany, 10/2021). Skin sensitiser.
butan-1-ol	Safe Work Australia (Australia, 12/2019). Absorbed through skin. PEAK: 152 mg/m ³ PEAK: 50 ppm
benzene, ethyl-	Safe Work Australia (Australia, 12/2019). STEL: 543 mg/m ³ 15 minutes. STEL: 125 ppm 15 minutes. TWA: 434 mg/m ³ 8 hours. TWA: 100 ppm 8 hours.

- Appropriate engineering controls** : Use only with adequate ventilation. Use process enclosures, local exhaust ventilation or other engineering controls to keep worker exposure to airborne contaminants below any recommended or statutory limits. The engineering controls also need to keep gas, vapour or dust concentrations below any lower explosive limits. Use explosion-proof ventilation equipment.
- Environmental exposure controls** : Emissions from ventilation or work process equipment should be checked to ensure they comply with the requirements of environmental protection legislation. In some cases, fume scrubbers, filters or engineering modifications to the process equipment will be necessary to reduce emissions to acceptable levels.

Individual protection measures

- Hygiene measures** : Wash hands, forearms and face thoroughly after handling chemical products, before eating, smoking and using the lavatory and at the end of the working period. Appropriate techniques should be used to remove potentially contaminated clothing. Contaminated work clothing should not be allowed out of the workplace. Wash contaminated clothing before reusing. Ensure that eyewash stations and safety showers are close to the workstation location.
- Eye/face protection** : Safety eyewear complying to ISO 16321-1:2022 should be used when a risk assessment indicates this is necessary to avoid exposure to liquid splashes, mists, gases or dusts. If contact is possible, the following protection should be worn, unless the assessment indicates a higher degree of protection: chemical splash goggles and/or face shield. If inhalation hazards exist, a full-face respirator may be required instead.
- Skin protection**
- Hand protection** : Chemical-resistant, impervious gloves complying with an approved standard should be worn at all times when handling chemical products if a risk assessment indicates this is necessary. Considering the parameters specified by the glove manufacturer, check during use that the gloves are still retaining their protective properties. It should be noted that the time to breakthrough for any glove material may be different for different glove manufacturers. In the case of mixtures, consisting of several substances, the protection time of the gloves cannot be accurately estimated.
- There is no one glove material or combination of materials that will give unlimited resistance to any individual or combination of chemicals.
The breakthrough time must be greater than the end use time of the product.
The instructions and information provided by the glove manufacturer on use, storage, maintenance and replacement must be followed.
Gloves should be replaced regularly and if there is any sign of damage to the glove material.
Always ensure that gloves are free from defects and that they are stored and used correctly.
The performance or effectiveness of the glove may be reduced by physical/chemical

Section 8. Exposure controls and personal protection

damage and poor maintenance.

Barrier creams may help to protect the exposed areas of the skin but should not be applied once exposure has occurred.

Wear suitable gloves tested to ISO 374-1:2016.

May be used, gloves(breakthrough time) 4 - 8 hours: Viton® (> 0.7 mm), neoprene (> 0.35 mm), butyl rubber (> 0.4 mm), PVC (> 0.5 mm)

Recommended, gloves(breakthrough time) > 8 hours: nitrile rubber (> 0.4 mm), 4H/Silver Shield® (> 0.07 mm), Teflon (> 0.35 mm), polyvinyl alcohol (PVA) (> 0.3 mm)

- Body protection** : Personal protective equipment for the body should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product. When there is a risk of ignition from static electricity, wear anti-static protective clothing. For the greatest protection from static discharges, clothing should include anti-static overalls, boots and gloves.
- Other skin protection** : Appropriate footwear and any additional skin protection measures should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product.
- Respiratory protection** : Based on the hazard and potential for exposure, select a respirator that meets the appropriate standard or certification. Respirators must be used according to a respiratory protection program to ensure proper fitting, training, and other important aspects of use.

Section 9. Physical and chemical properties

Appearance

- Physical state** : Liquid.
- Colour** : Pink, Grey, Yellow.
- Odour** : Characteristic.
- Odour threshold** : Not applicable.
- pH** : Not applicable.
- Melting point** : Not applicable.
- Boiling point** : Lowest known value: 119°C (246.2°F) (butan-1-ol). Weighted average: 181.91°C (359.4°F)
- Flash point** : Closed cup: 29°C (84.2°F)
- Evaporation rate** : Highest known value: 0.84 (ethylbenzene) Weighted average: 0.69 compared with butyl acetate
- Flammability (solid, gas)** : Not available.
- Lower and upper explosive (flammable) limits** : 0.43 - 11.3%
- Vapour pressure** : Highest known value: 1.2 kPa (9.3 mm Hg) (at 20°C) (ethylbenzene). Weighted average: 0.62 kPa (4.65 mm Hg) (at 20°C)
- Vapour density** : Highest known value: 11.7 (Air = 1) (epoxy resin (MW ≤ 700)). Weighted average: 6.11 (Air = 1)
- Relative density** : 1.66 to 1.669 g/cm³
- Solubility** : Insoluble in the following materials: cold water and hot water.
- Partition coefficient: n-octanol/water** : Not available.
- Auto-ignition temperature** : Lowest known value: 355°C (671°F) (butan-1-ol).
- Decomposition temperature** : Not available.
- Viscosity** : Kinematic (40°C (104°F)): >20.5 mm²/s (>20.5 cSt)

Section 10. Stability and reactivity

Reactivity	: No specific test data related to reactivity available for this product or its ingredients.
Chemical stability	: The product is stable.
Possibility of hazardous reactions	: Under normal conditions of storage and use, hazardous reactions will not occur.
Conditions to avoid	: Avoid all possible sources of ignition (spark or flame). Do not pressurise, cut, weld, braze, solder, drill, grind or expose containers to heat or sources of ignition.
Incompatible materials	: Keep away from the following materials to prevent strong exothermic reactions: oxidising agents, strong alkalis, strong acids.
Hazardous decomposition products	: Under normal conditions of storage and use, hazardous decomposition products should not be produced.

Section 11. Toxicological information

There are no data available on the mixture itself. The mixture has been assessed following the conventional method of the CLP Regulation (EC) No 1272/2008 and is classified for toxicological properties accordingly. See Sections 2 and 3 for details.

Exposure to component solvent vapour concentrations in excess of the stated occupational exposure limit may result in adverse health effects such as mucous membrane and respiratory system irritation and adverse effects on the kidneys, liver and central nervous system. Symptoms and signs include headache, dizziness, fatigue, muscular weakness, drowsiness and, in extreme cases, loss of consciousness.

Solvents may cause some of the above effects by absorption through the skin. Repeated or prolonged contact with the mixture may cause removal of natural fat from the skin, resulting in non-allergic contact dermatitis and absorption through the skin.

If splashed in the eyes, the liquid may cause irritation and reversible damage.

Ingestion may cause nausea, diarrhea and vomiting.

This takes into account, where known, delayed and immediate effects and also chronic effects of components from short-term and long-term exposure by oral, inhalation and dermal routes of exposure and eye contact.

Based on the properties of the epoxy constituent(s) and considering toxicological data on similar mixtures, this mixture may be a skin sensitiser and an irritant. It contains low molecular weight epoxy constituents which are irritating to eyes, mucous membrane and skin. Repeated skin contact may lead to irritation and to sensitisation, possibly with cross-sensitisation to other epoxies. Skin contact with the mixture and exposure to spray mist and vapour should be avoided.

Contains epoxy resin (MW 700-1200), epoxy resin (MW ≤ 700). May produce an allergic reaction.

Information on toxicological effects

Acute toxicity

Product/ingredient name	Result	Species	Dose	Exposure
xylene	LC50 Inhalation Vapour	Rat	20 mg/l	4 hours
	LD50 Oral	Rat	4300 mg/kg	-
epoxy resin (MW ≤ 700)	TDL ₀ Dermal	Rabbit	4300 mg/kg	-
	LD50 Dermal	Rabbit	20 g/kg	-
butan-1-ol	LD50 Oral	Mouse	15600 mg/kg	-
	LD50 Oral	Rat	790 mg/kg	-
benzene, ethyl-	LC50 Inhalation Vapour	Rat - Male	17.8 mg/l	4 hours
	LD50 Dermal	Rabbit	>5000 mg/kg	-
	LD50 Oral	Rat	3500 mg/kg	-

Irritation/Corrosion

Product/ingredient name	Result	Species	Score	Exposure	Observation
xylene	Eyes - Mild irritant	Rabbit	-	87 milligrams	-
	Skin - Mild irritant	Rat	-	8 hours 60 microliters	-
epoxy resin (MW 700-1200)	Eyes - Mild irritant	Mammal - species unspecified	-	-	-
	Skin - Mild irritant	Mammal - species unspecified	-	-	-

Section 11. Toxicological information

epoxy resin (MW ≤ 700)	Eyes - Severe irritant	Rabbit	-	24 hours 2 milligrams	-
	Skin - Mild irritant	Rabbit	-	500 milligrams	-

Sensitisation

Product/ingredient name	Route of exposure	Species	Result
epoxy resin (MW 700-1200)	skin	Mammal - species unspecified	Sensitising
epoxy resin (MW ≤ 700)	skin	Mammal - species unspecified	Sensitising

Mutagenicity

Not available.

Carcinogenicity

Not available.

Reproductive toxicity

Not available.

Teratogenicity

Not available.

Specific target organ toxicity (single exposure)

Name	Category	Route of exposure	Target organs
xylene	Category 3	-	Respiratory tract irritation
butan-1-ol	Category 3	-	Respiratory tract irritation
	Category 3	-	Narcotic effects

Specific target organ toxicity (repeated exposure)

Name	Category	Route of exposure	Target organs
benzene, ethyl-	Category 2	-	-

Aspiration hazard

Name	Result
xylene	ASPIRATION HAZARD - Category 1
benzene, ethyl-	ASPIRATION HAZARD - Category 1

Information on likely routes of exposure : Not available.

Potential acute health effects

- Eye contact** : Causes serious eye damage.
- Inhalation** : No known significant effects or critical hazards.
- Skin contact** : Causes skin irritation. May cause an allergic skin reaction.
- Ingestion** : No known significant effects or critical hazards.

Symptoms related to the physical, chemical and toxicological characteristics

Section 11. Toxicological information

- Eye contact** : Adverse symptoms may include the following:
pain
watering
redness
- Inhalation** : No specific data.
- Skin contact** : Adverse symptoms may include the following:
pain or irritation
redness
blistering may occur
- Ingestion** : Adverse symptoms may include the following:
stomach pains

Delayed and immediate effects as well as chronic effects from short and long-term exposure

Short term exposure

- Potential immediate effects** : Not available.
- Potential delayed effects** : Not available.

Long term exposure

- Potential immediate effects** : Not available.
- Potential delayed effects** : Not available.

Potential chronic health effects

Not available.

- General** : Once sensitized, a severe allergic reaction may occur when subsequently exposed to very low levels.
- Carcinogenicity** : No known significant effects or critical hazards.
- Mutagenicity** : No known significant effects or critical hazards.
- Teratogenicity** : No known significant effects or critical hazards.
- Developmental effects** : No known significant effects or critical hazards.
- Fertility effects** : No known significant effects or critical hazards.

Numerical measures of toxicity

Acute toxicity estimates

Route	ATE value
Oral	8333.33 mg/kg
Dermal	10114.94 mg/kg
Inhalation (vapours)	133.8 mg/l

Section 12. Ecological information

Toxicity

Product/ingredient name	Result	Species	Exposure
xylene	Acute LC50 8500 µg/l Marine water	Crustaceans - Palaemonetes pugio	48 hours
epoxy resin (MW ≤ 700)	Acute LC50 13400 µg/l Fresh water	Fish - Pimephales promelas	96 hours
	Acute EC50 1.4 mg/l	Daphnia	48 hours
	Acute LC50 3.1 mg/l	Fish - pimephales promelas	96 hours
	Chronic NOEC 0.3 mg/l	Fish	21 days
benzene, ethyl-	Acute EC50 7700 µg/l Marine water	Algae - Skeletonema costatum	96 hours
	Acute EC50 2.93 mg/l	Daphnia	48 hours

Section 12. Ecological information

	Acute LC50 4.2 mg/l	Fish	96 hours
--	---------------------	------	----------

Persistence and degradability

Product/ingredient name	Aquatic half-life	Photolysis	Biodegradability
xylene	-	-	Readily
epoxy resin (MW ≤ 700)	-	-	Not readily
benzene, ethyl-	-	-	Readily

Bioaccumulative potential

Product/ingredient name	LogP _{ow}	BCF	Potential
xylene	3.12	8.1 to 25.9	low
epoxy resin (MW ≤ 700)	2.64 to 3.78	31	low
butan-1-ol	1	-	low
benzene, ethyl-	3.6	-	low

Mobility in soil

Soil/water partition coefficient (K_{oc}) : Not available.





Other adverse effects : No known significant effects or critical hazards.

Section 13. Disposal considerations

Disposal methods : The generation of waste should be avoided or minimised wherever possible. Disposal of this product, solutions and any by-products should at all times comply with the requirements of environmental protection and waste disposal legislation and any regional local authority requirements. Dispose of surplus and non-recyclable products via a licensed waste disposal contractor. Waste should not be disposed of untreated to the sewer unless fully compliant with the requirements of all authorities with jurisdiction. Waste packaging should be recycled. Incineration or landfill should only be considered when recycling is not feasible. This material and its container must be disposed of in a safe way. Care should be taken when handling emptied containers that have not been cleaned or rinsed out. Empty containers or liners may retain some product residues. Vapour from product residues may create a highly flammable or explosive atmosphere inside the container. Do not cut, weld or grind used containers unless they have been cleaned thoroughly internally. Avoid dispersal of spilt material and runoff and contact with soil, waterways, drains and sewers.

Do not allow to enter drains or watercourses. Material and/or container must be disposed of as hazardous waste.

Section 14. Transport information

	ADG	ADR/RID	IMDG	IATA
UN number	UN1263	UN1263	UN1263	UN1263
UN proper shipping name	Paint	Paint	Paint	Paint
Transport hazard class(es)	3 	3 	3 	3 
Packing group	III	III	III	III

Section 14. Transport information

Environmental hazards	No.	No.	No.	No.
Additional information	Hazchem code •3Y	Hazard identification number 30 Tunnel code (D/E)	Emergency schedules F-E, S-E	The environmentally hazardous substance mark may appear if required by other transportation regulations.

Special precautions for user : **Transport within user's premises:** always transport in closed containers that are upright and secure. Ensure that persons transporting the product know what to do in the event of an accident or spillage.

Transport in bulk according to IMO instruments : Not available.

Transport within user's premises: always transport in closed containers that are upright and secure. Ensure that persons transporting the product know what to do in the event of an accident or spillage.

Transport in accordance with ADR/RID, IMDG/IMO and ICAO/IATA and national regulation.

ADR / RID : ADR/RID: Viscous substance. Not restricted, ref. chapter 2.2.3.1.5 (applicable to receptacles < 450 litre capacity).

IMDG : IMDG: Viscous substance. Transport in accordance with paragraph 2.3.2.5 (applicable to receptacles < 450 litre capacity).

Section 15. Regulatory information

Standard for the Uniform Scheduling of Medicines and Poisons

5

Model Work Health and Safety Regulations - Scheduled Substances

<u>Ingredient name</u>	<u>Schedule</u>
silica, crystalline - quartz	Restricted hazardous chemical [For abrasive blasting at a concentration of greater than 1%]

Australia inventory (AIC) : Not determined.

International regulations

Chemical Weapon Convention List Schedules I, II & III Chemicals

Not listed.

Montreal Protocol

Not listed.

Stockholm Convention on Persistent Organic Pollutants

Not listed.

UNECE Aarhus Protocol on POPs and Heavy Metals

Not listed.

Section 16. Any other relevant information

History

Date of printing	: 15.06.2023
Date of issue/Date of revision	: 15.06.2023
Date of previous issue	: 16.11.2022
Version	: 1.08
Key to abbreviations	: ADG = Australian Dangerous Goods ATE = Acute Toxicity Estimate BCF = Bioconcentration Factor GHS = Globally Harmonized System of Classification and Labelling of Chemicals IATA = International Air Transport Association IBC = Intermediate Bulk Container IMDG = International Maritime Dangerous Goods LogPow = logarithm of the octanol/water partition coefficient MARPOL = International Convention for the Prevention of Pollution From Ships, 1973 as modified by the Protocol of 1978. ("Marpol" = marine pollution) NOHSC = National Occupational Health and Safety Commission SUSMP = Standard for the Uniform Scheduling of Medicines and Poisons UN = United Nations

Procedure used to derive the classification

Classification	Justification
FLAMMABLE LIQUIDS - Category 3 SKIN CORROSION/IRRITATION - Category 2 SERIOUS EYE DAMAGE/EYE IRRITATION - Category 1 SKIN SENSITISATION - Category 1 LONG-TERM (CHRONIC) AQUATIC HAZARD - Category 3	On basis of test data Calculation method Calculation method Calculation method Calculation method

References : Not available.

🔍 Indicates information that has changed from previously issued version.

Disclaimer

The information in this document is given to the best of Jotun's knowledge, based on laboratory testing and practical experience. Jotun's products are considered as semi-finished goods and as such, products are often used under conditions beyond Jotun's control. Jotun cannot guarantee anything but the quality of the product itself. Minor product variations may be implemented in order to comply with local requirements. Jotun reserves the right to change the given data without further notice.

Users should always consult Jotun for specific guidance on the general suitability of this product for their needs and specific application practices.

If there is any inconsistency between different language issues of this document, the English (United Kingdom) version will prevail.